General Information

This electronic speedometer utilizes a LCD to display odometer and trip odometer mileage. Momentarily pressing of the Red button, the odometer / trip odometer information displayed on the LCD. Pressing the button, while in trip mode, for more than two seconds will reset the trip odometer. The odometer can not be reset.

Calibration

1. Speedometer and sender must be installed properly and all wires must be connected correctly.
2. To set the speedometer in calibration mode:
   a) With power to the speedometer OFF, press and hold red button.
   b) While holding the red button, turn power ON to the speedometer.
   c) After 3.5seconds,the LCD would display RPM as below for an option:
      KMH—700-1000-1400
      MPH—1000-2000-2240
   d) Momentarily pressing Red button to change the data until get the correct RPM.
   e) Release red button for 3.5seconds, the pointer would scan and run back to zero. Calibration is completed.

Tach.

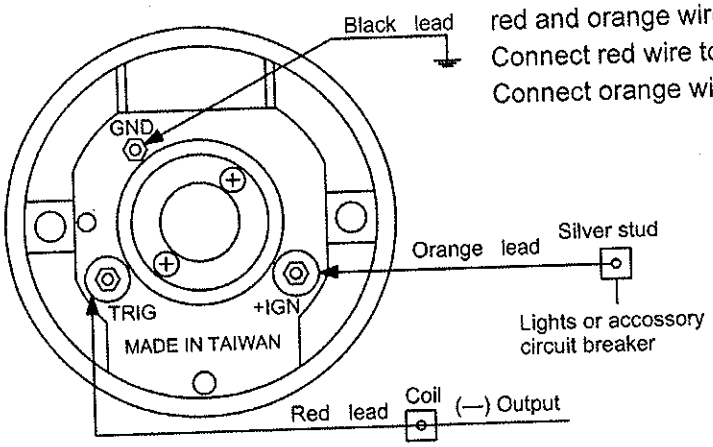

Route wires along frame to speedo/tach mounting area. Trim wires and conduit to proper length and terminate ends of both red and orange wires.
Connect red wire to "trig" stud on tach.
Connect orange wire to "ign" stud on tach.