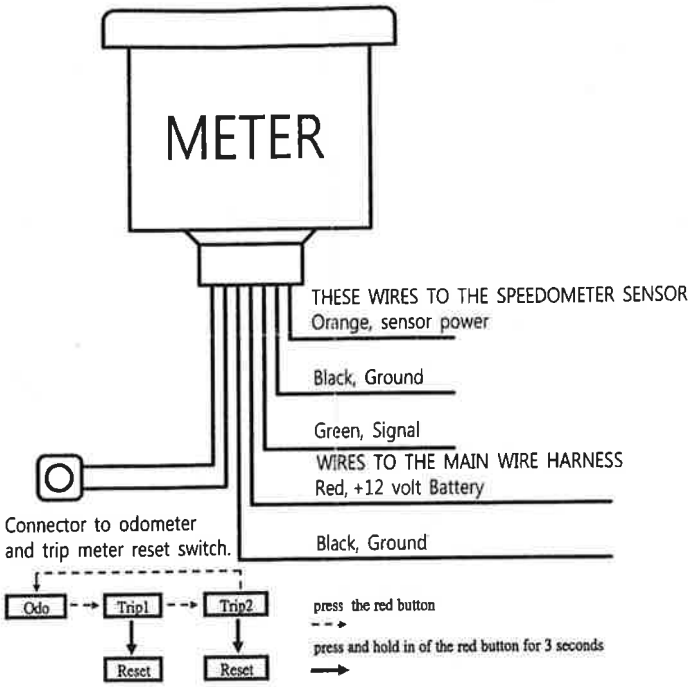

METER
THESE WIRES TO THE SPEEDOMETER SENSOR
Orange, sensor power
Black, Ground
Green, Signal
WIRES TO THE MAIN WIRE HARNESS
Red, +12 volt Battery
Black, Ground
Connector to odometer
and trip meter reset switch.
Odo
Trip1
Trip2
Reset
Reset
press the red button
press and hold in of the red button for 3 seconds